


## Downlights Supplemental Installation Instructions


### Installation - Tools Needed

- All Necessary Safety Items
- MC Cutter & Wire Strippers
- Lineman Pliers
- Phillips Head Bit
- Cordless Drill/Driver
- 1 1/4" Hole Saw Bit

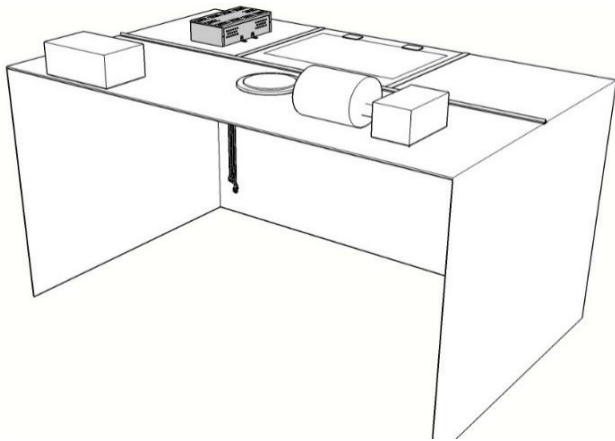


### 1. Install down-light power supply box.

- Place supply box on canopy in accessible location. (**DO NOT** install power supply between drop ceiling & canopy. This will reduce unit life and void warranty.
- Drill 1 1/4" diameter hole through canopy where box will be mounted.
- Install plastic bushing in hole. Insert wiring harness through plastic bushing.
- Mount supply box to canopy with (4) supplied self-tapping screws.
- **DO NOT** supply power to box. For more details, see installation instructions in light kit box.

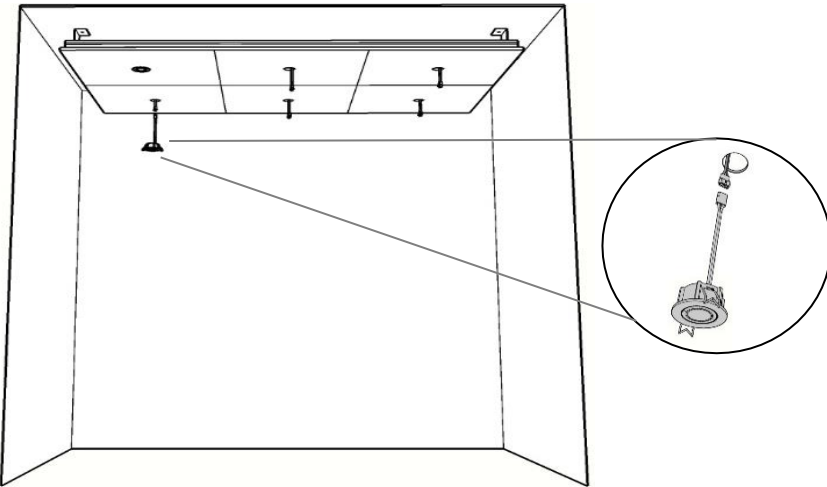

### 2. Install down-lights.

- Pull one wire connection from power supply harness to each hole in ceiling (those with red connectors closest to COP).
- Connect plugs from harness and light fixture, pull back springs on light fixture, insert fixture into ceiling hole, gently release springs, push fixture into place.
- Repeat until each light fixture is installed.
- See more detailed installation instructions in light kit box.

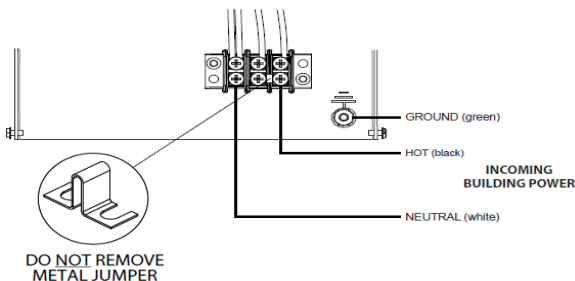

The metal jumper (marked in orange) will be removed **ONLY** when using a keyswitch. If you are not using a keyswitch, the jumper must remain in place.

### 3. Make final power connection.

- After installer inside cab connects all down-lights, complete power supply installation.
- **Make sure power is off before connecting building power to light power supply box.**
- Bring 120 VAC line into box. Connect hot and neutral wires to terminal strip. Connect ground wire to threaded stud.
- Only if using a key switch or timeout circuit, remove orange metal jumper. Otherwise, leave jumper in place.
- Continue to follow wiring diagram found in light kit for further instructions.